

Sieve Analysis Report

CLIENT:	Metro Green	DATE:	2/9/2026
PROJECT:	YARD STOCK PILE	LAB NO:	20812
SAMPLE ID:	Screened fill	TIME IN:	8am
RECEIVED:		TIME OUT:	3pm
INSPECTOR:	Dale Joseph		

Sieve Size	Grain Size (mm)	Grams		RESULTS	
		Weight Retained	% Retained	Cumulative % Retained	% Passing
1"	25.4	0	0	0	100
3/4"	19.05	12.7	1.38	1.38	98.62
1/2"	12.7	65.6	7.15	8.53	91.47
3/8"	9.525	77.8	8.48	17.01	82.99
#4 - 1/4"	4.75	190.4	20.75	37.76	62.24
#10 - 1/10"	2.45	164.2	17.89	55.65	44.35
#40 - 1/40"	0.635	301.7	32.88	88.53	11.47
#60 - 1/60"	0.423	40.3	4.39	92.92	7.08
#200 - 1/200"	0.127	24.3	2.65	95.57	4.43
Pan		40.6	4.43	100	0

Wet Soil (Ws): 989.2

Dry Soil (Ds): 917.6

Moisture Content: 7.24%

RESULTS:	<ol style="list-style-type: none"> 1. CONTAINS LESS THAN 5% FINES AND FINE MATERIAL. 2. MATERIAL CONFORMS TO THE REQUIREMENTS OF SECTION 304 OF NYS DOT S.S. FOR TYPE 4 MATERIAL.
-----------------	---

EQUIPMENT USED:	Sieves; SN: CTL-SIV003 / CTLSIV038 Shaker, SN: -CTMSS002; Scale SN: CTL-SCL-003
------------------------	--

Respectfully submitted,
CERTIFIED TESTING LABORATORIES, INC

VS/dk

Vladimir Sirota, PE



EeCTL SOF S-3



CTL

CERTIFIED TESTING LABORATORIES, INC.

PICTURE NO.:

CLIENT: *Metro Green*

DATE: *2/9/26*

PROJECT: *Screwed Fill*


TIME IN:

CONTRACTOR:

TIME OUT:

ARCHITECT/ENGINEER:

INSPECTOR:

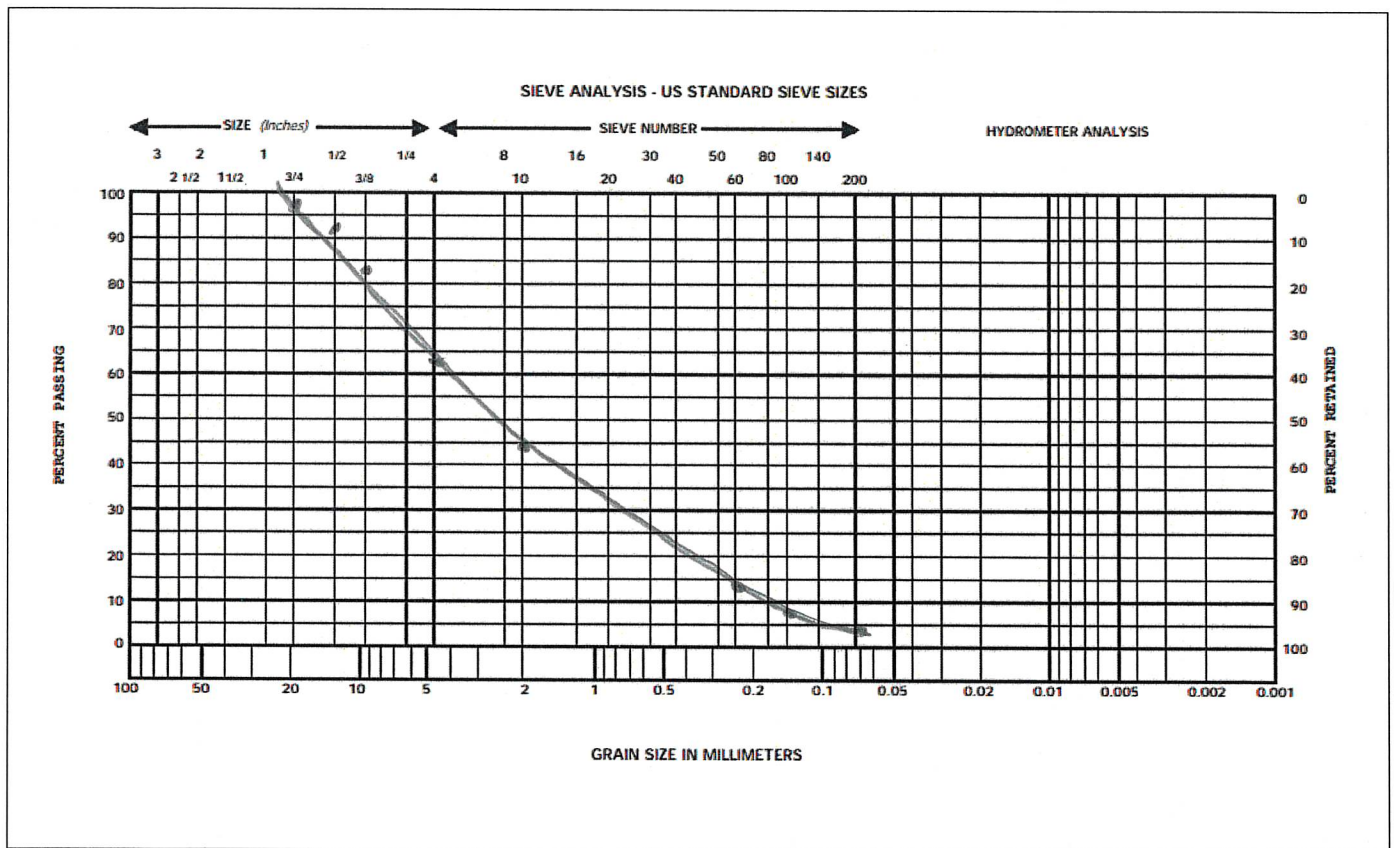

PICTURE OF: Sieve Analysis Graph

FLOOR:

LOCATION ON FLOOR:

DATE:

CTL SOF-35
4/10/2020
KD

THIS INSPECTION REPORT RELATES ONLY TO THE ITEMS INSPECTED/TESTED AS MENTIONED ABOVE.

All reports are the confidential property of Clients, and information contained may not be published or reproduced, pending our written approval.
140 Marbledale Road ° Tuckahoe, New York 10707 ° (718) 824-1616 ° Fax (914) 335-3089